


COMMERCIAL - TECHNICAL DATA / Tecnologia

COTTON POPELIN ECO

97% COTTON BCI  
3% SPANDEX

Test Method for Woven Fabrics		STANDARD (estandar)		DIGITAL PRINT		
Width / Ancho NTC 228-2011		In	Cms	In	Cms	
		Phisic / Físico	59	150	59	150
		Useful / Util	57	145	57	145
Weight / Peso ASTM D 3776-2009		Oz/syd	Gsm	Oz/syd	Gsm	
		3.63	123	3.66	124	
Shrinkage / Cambio dimensional (%) 135-2004 / IN504-15	Lenght / Longitud	5%		5%		
	Trans / Transversal	4%		4%		
Spirality after laundry / Viraje despues del lavado (%) ISO16322-2-2005	Lenght / Longitud	3%		3%		
	Trans / Transversal					
Color fastness to wash / Solidez al lavado (gray scale) AATCC 61-2007	Change / Cambio	4		4		
	Stain / Transf	3		3		
Dye transfer to storage. Option II (gray scale) / Transferencia del color por almacenamiento. Opcion II AATCC 163-2007	Stain / Transf	4		4		
Color fastness to light (gray scale) / Solidez a la luz BS 1006-1990	Change / Cambio	4		4		
Color fastness to crocking (gray scale) / Solidez al frote AATCC 8-2007	Dry / Seco	4		4		
	Wet / Húmedo	3		3		
Color Fastness to perspiration (gray scale) / Solidez a la transpiración AATCC 15-2007	Change / Cambio	4		4		
	Stain / Transf	3		3		
Pilling / Pilling (Photographic) NTC 2051-2 / 2003		3		3		
Type of fabric / Tipo de tejido				Woven		

Reviewed by

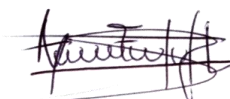

ANDRES LOPEZ

**Recommendations:**

Rest for 20 to 24 hours before cutting.

Make prior tests of fusion or dyeing if is required. High shrinkage fabric.

